

P603-15661

ADDENDUM NUMBER 2

SMITH PARK PAVILION
RETAINING WALL REPAIRS
Site #708, Bldg. #1470
5462 North 33rd Street
Milwaukee, WI 53209

Project Number: P603-15661

Notice Number: 7124

Date of Addendum: 9/15/16

This Addendum to the Contract Documents is issued to modify, explain or correct the original documents, dated July 31, 2016, and is hereby made part of the Contract Documents. Acknowledge receipt of this Addendum in the space provided on the Bid Form, or bid may be rejected.


BIDDING DOCUMENTS

Additional two PDF drawings posted on Milwaukee County's website to further quantify the amount of repair work needed for retaining walls.

See the following path for the drawings:

<http://county.milwaukee.gov/ImageLibrary/Groups/cntyArchEng/dturzai/09172013forward/SmithParkPavilionRetainingWallRepairs.ADDMN2.pdf>

End of Addendum No. 2

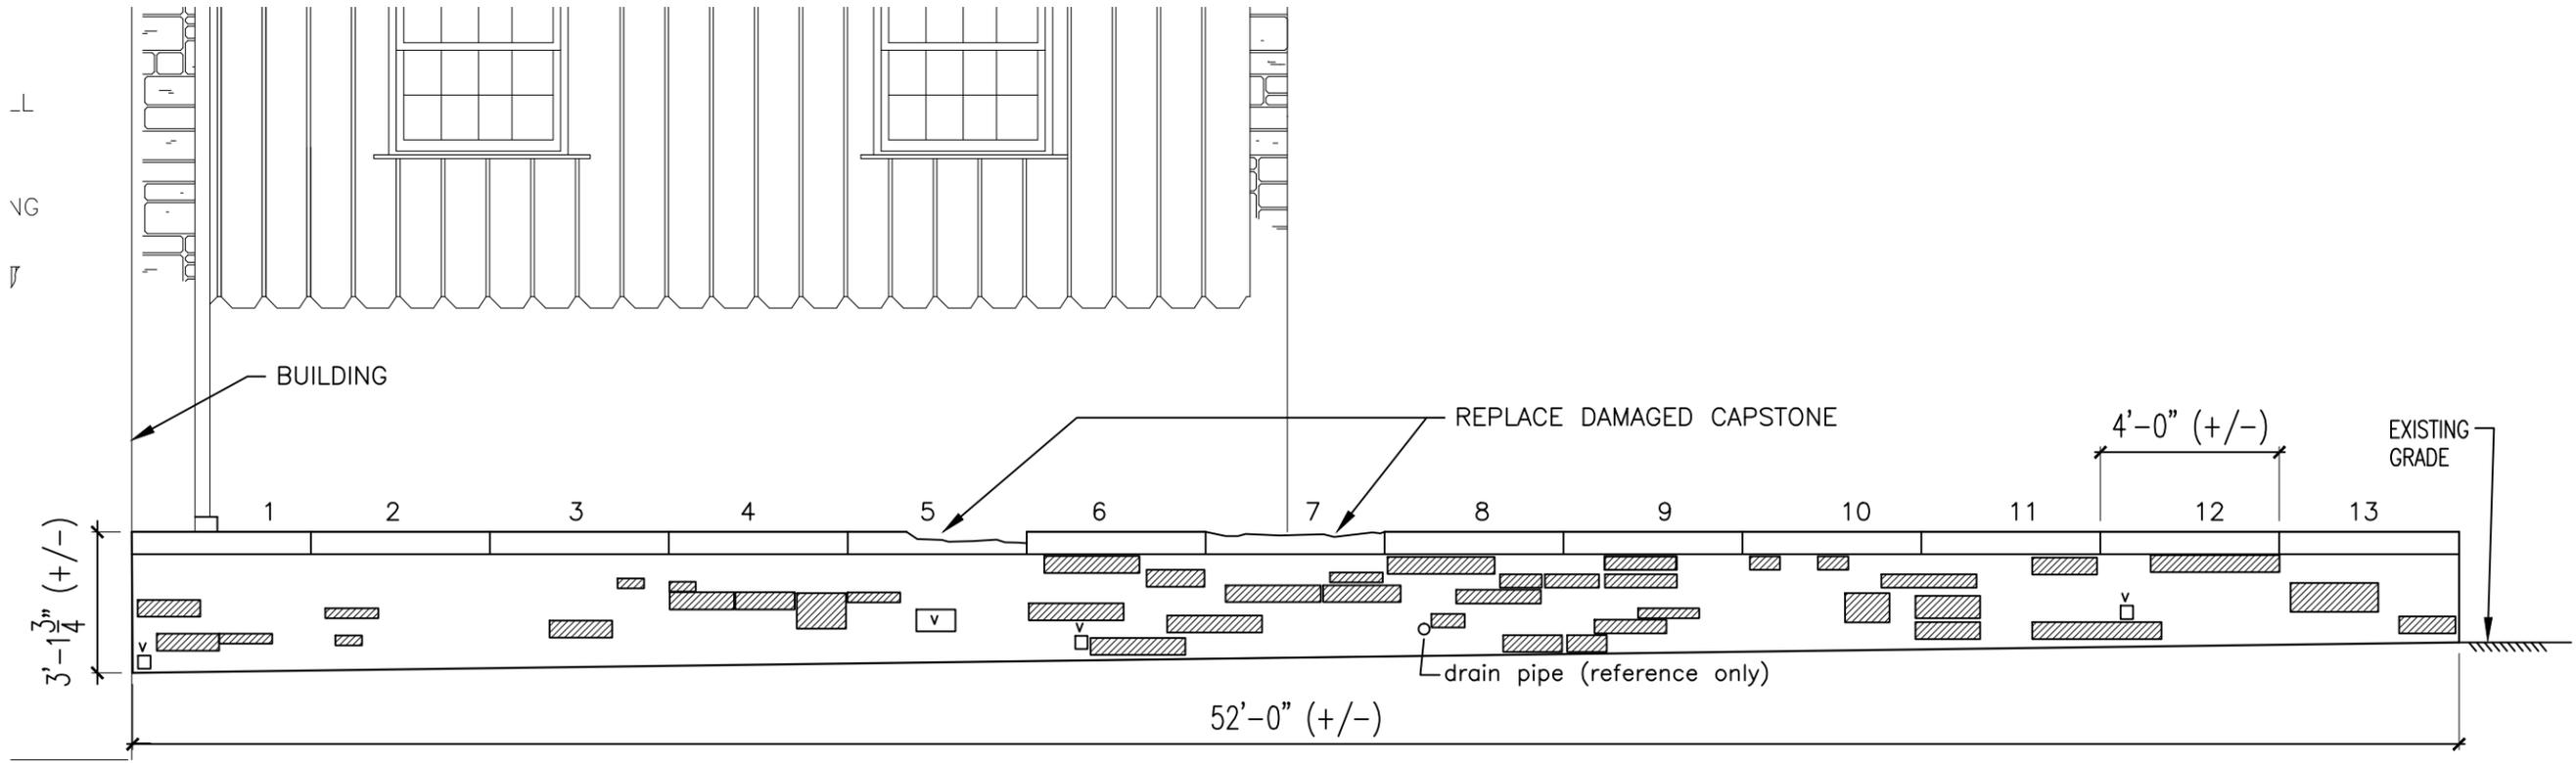

NORTH WALL RESTORATION (REPAIR QUANTITIES)

(LOOKING WEST) SCALE 1/4" = 1'-0"

- 35.00 SF PARTIAL DEPTH REPAIR
- 20 LF EPOXY RESIN INJECTING

NOTES:


- 1.) COMPLETE ALL REPAIR WORK LISTED IN ORIGINAL BID DOCUMENTS PLANS 1 THRU 8.
- THE INTENT OF BELOW ITEMS ARE TO FURTHER QUANTIFY THE AMOUNT OF REPAIR WORK NEEDED:
- 2.) REPAIRS SPOTS SHOWN ON WALL ARE AREAS OF CRACKED STONE THAT ARE TO BE REPAIRED WITH A PARTIAL DEPTH REPAIR. FIELD VERIFY. REMOVE OLD DAMAGED STONE (4" TO 6" FROM FACE) AND REPLACE. 
- 3.) REPAIRS SPOTS SHOWN ON WALL WITH A "V" ARE AREAS OF STONE THAT HAVE A VOID AND ARE TO BE REPAIRED WITH A PARTIAL DEPTH REPAIR. 
- 4.) REPAIRS SPOTS SHOWN ON WALL WITH A "VF" ARE AREAS OF STONE THAT HAVE A MISSING STONES AND ARE TO BE REPAIRED WITH A FULL DEPTH REPAIR. (REPLACE ENTIRE STONE UNIT). 
- 5.) COMPETENT STONE MASONRY UNITS WITH NO MORE THAN TWO CRACKS SHALL BE REPAIRED WITH EPOXY RESIN GROUTING.

DATE:	REVISION:	BY:



MILWAUKEE COUNTY DEPARTMENT OF
PARKS & PUBLIC INFRASTRUCTURE
 Architecture, Engineering &
 Environmental Services Section
 CITY CAMPUS 2711 W. WELLS ST. SECOND FLOOR MILWAUKEE, WI 53208

SHEET NO.	PROJECT NO.	SITE NO.	PROJECT TITLE	SCALE	DRAWN BY:
1 OF 2	P603	708	SMITH PARK RETAINING WALL REPAIRS	NONE	MJS
FILE NO.	BUILDING NO.	SHEET DESCRIPTION:	DATE	CHECKED BY:	
		ADDENDUM #2: WALL ELEVATIONS	9-15-16	KDS	

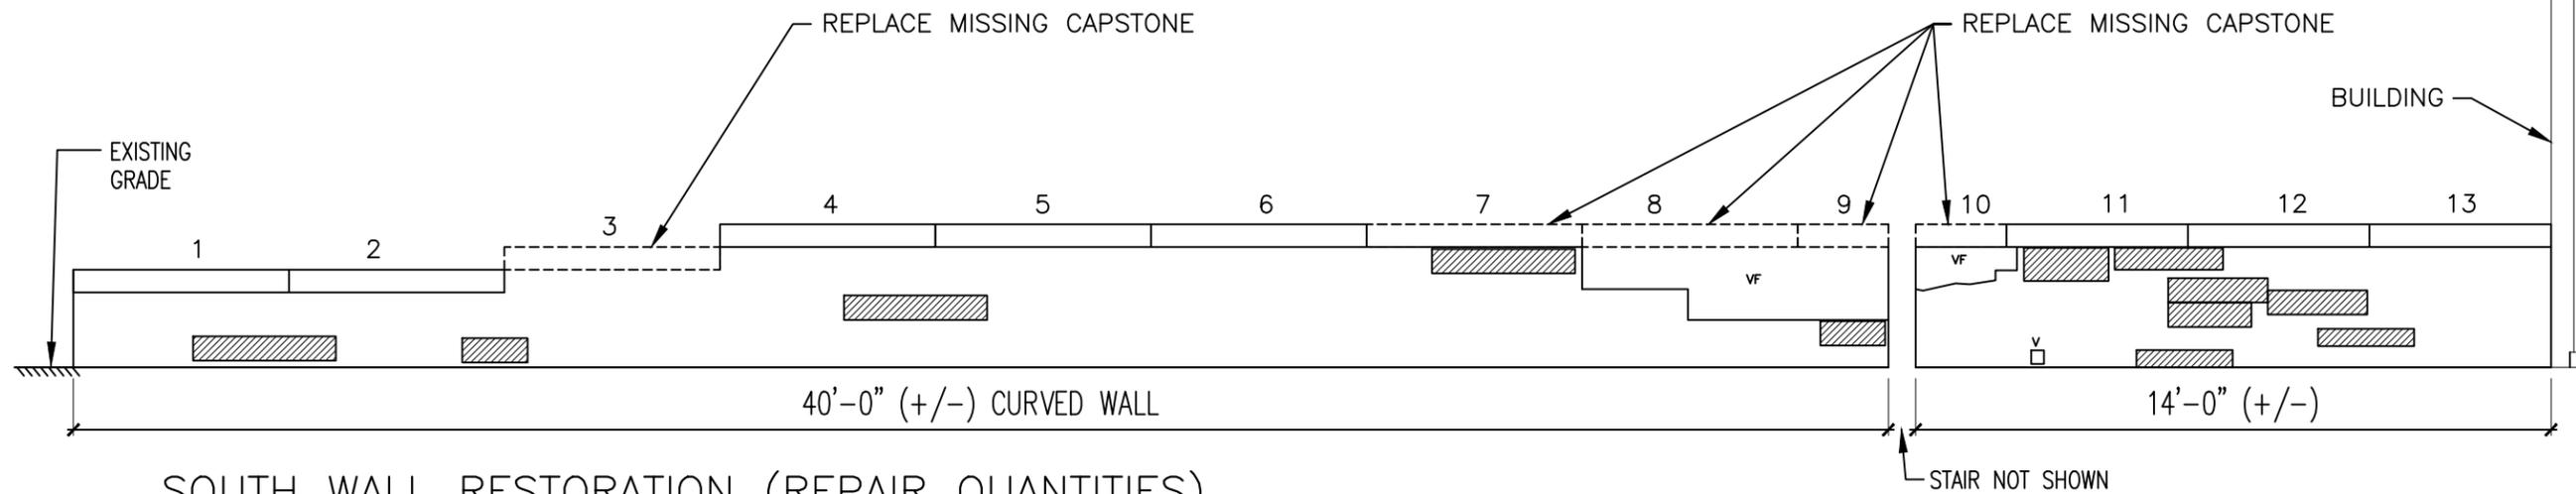


SOUTH WALL RESTORATION (REPAIR QUANTITIES)

(LOOKING WEST) SCALE 1/4" = 1'-0"

40.00 SF PARTIAL DEPTH REPAIR


16.00 SF FULL DEPTH REPAIR

30 LF EPOXY RESIN INJECTING

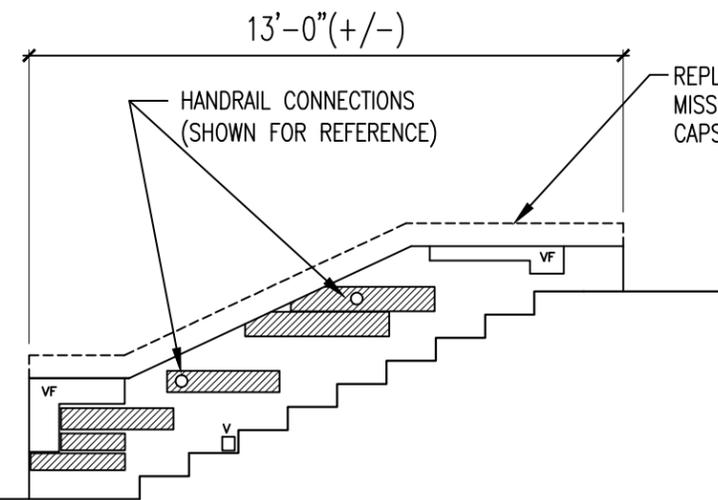

SOUTH PORTION OF SOUTH STAIR WALL RESTORATION

(LOOKING SOUTH)

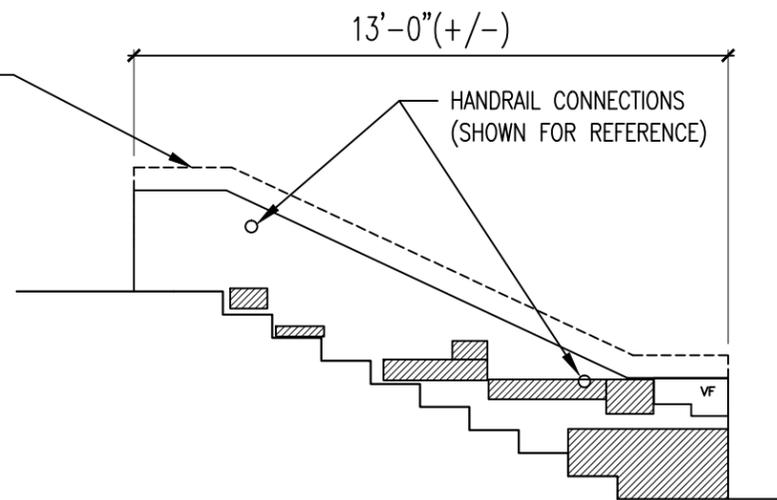

NORTH PORTION OF SOUTH STAIR WALL RESTORATION

(LOOKING NORTH)

REPLACE MISSING STAIR RAILING WITH NEW GALVANIZED METAL PIPE RAILING, APPROX. 10'-0" (+/-) LONG, MATCH EXISTING

NOTES:

1.) COMPLETE ALL REPAIR WORK LISTED IN ORIGINAL BID DOCUMENTS PLANS 1 THRU 8.

THE INTENT OF BELOW ITEMS ARE TO FURTHER QUANTIFY THE AMOUNT OF REPAIR WORK NEEDED:

2.) REPAIRS SPOTS SHOWN ON WALL ARE AREAS OF CRACKED STONE THAT ARE TO BE REPAIRED WITH A PARTIAL DEPTH REPAIR. FIELD VERIFY. REMOVE OLD DAMAGED STONE (4" TO 6" FROM FACE) AND REPLACE.



3.) REPAIRS SPOTS SHOWN ON WALL WITH A "V" ARE AREAS OF STONE THAT HAVE A VOID AND ARE TO BE REPAIRED WITH A PARTIAL DEPTH REPAIR.



4.) REPAIRS SPOTS SHOWN ON WALL WITH A "VF" ARE AREAS OF STONE THAT HAVE A MISSING STONES AND ARE TO BE REPAIRED WITH A FULL DEPTH REPAIR. (REPLACE ENTIRE STONE UNIT).



5.) COMPETENT STONE MASONRY UNITS WITH NO MORE THAN TWO CRACKS SHALL BE REPAIRED WITH EPOXY RESIN GROUTING.

BY:	
DATE:	
REVISION:	



MILWAUKEE COUNTY DEPARTMENT OF
PARKS & PUBLIC INFRASTRUCTURE
Architecture, Engineering &
Environmental Services Section
CITY CAMPUS 2711 W. WELLS ST. SECOND FLOOR MILWAUKEE, WI 53208

DRAWN BY:	MJS	CHECKED BY:	KDS
SCALE:	NONE	DATE:	9-15-16
PROJECT TITLE:	SMITH PARK RETAINING WALL REPAIRS		
SHEET DESCRIPTION:	ADDENDUM #2: WALL ELEVATIONS		
SITE NO.:	708	BUILDING NO.:	
PROJECT NO.:	P603		
SHEET NO.:	2 OF 2		
FILE NO.:			

C:\Users\marksifuentes\AppData\Local\Temp